
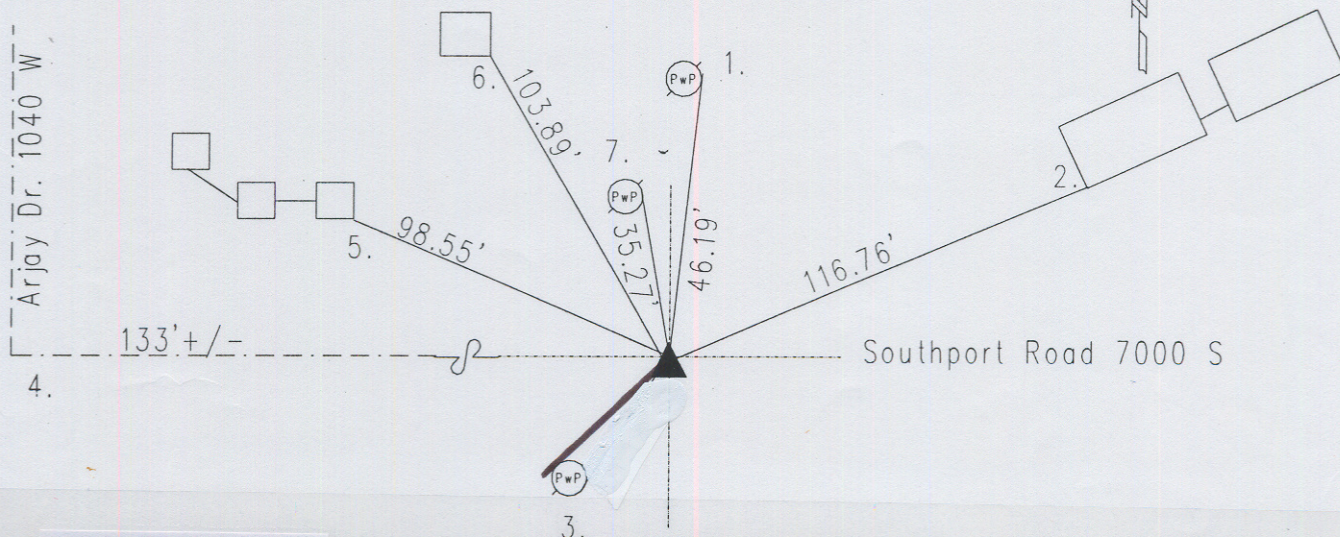


OFFICE OF THE MARION COUNTY SURVEYOR
SECTION RECORD CORNER
SECTION 14 TOWNSHIP 14 RANGE 3
DATE: -3-18-01- 4-29-08
PARTY CHIEF: Whiteside Wilcoxon
CREW: _____
TYPE OF MARKER: Harrison
METHOD OF ESTABLISHMENT: County: 6-4-96

IN. S.P.C. E ZONE, NAD 83
NAME: 14031401
N: 490330.9715(m)
E: 56165.7031(m)

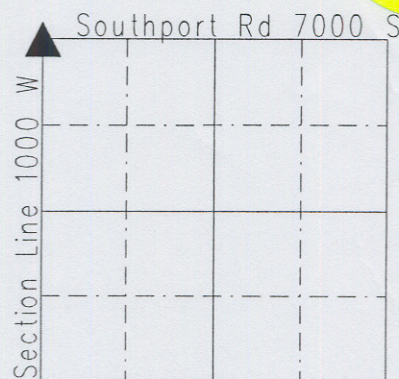

14031401 NW corner

CORNER HISTORY: Corner originally set as a post in 1820 by Wm. B. Laughlin with witness: 10" hackberry N 27 E 27 links; 10" hickory S 20 links per Marion County Atlas pg. 5. A survey 8-30-1881 by H. B. Fatout called witness: 18" hackberry N 12 E 45 links per Perry Township Legal Survey Book pg. 1. Survey dated 6-6-1851 called same witness per Perry Book pg. 23. Survey dated 4-21-1858 by R. Mayhew called found witness but under water per Perry Book pg. 23. Survey dated 5-23-1972 by J. Prout called out corner per legal survey. Reference dated 9-9-1977 by Wilcoxon called established by subdivision plats and a railroad spike was set. Reference dated 6-19-86 by Green called tied in railroad spike as corner. Reference dated 6-12-90 by Greene called railroad spike as corner. Excavated by Kiste and found railroad spike at surface and stone was found, set Harrison. Reference dated 1999 by Don Mosson of American Consulting (later known as American Structurepoint) thought the corner was off. MCSO traversed the subdivision to re-locate the corner. Sewer work dated 4-02-08 by Wilcoxon re-set the Harrison and also located an old hub 17" down.

HC 431401

REF.	DISTANCE	DESCRIPTION
1.	46.19'	PK nail E PwP#236-754 12"up
2.	116.76'	Southerly corner of brick
3.	31.13'	PK nail w/MCSO washer NW PwP#59-754 18"up
4.	133'+/-	Due W to C/L of Arjay Drive
5.	98.55'	SE corner of brick column
6.	103.89'	SE corner of brick for ADDRESS 6967
7.	35.27'	PK nail E PwP#212-753 20"up